


P2 Bridge Preservation - Steel Bridge Painting Projects

2009-11 Bien Priority Array

(Sorted by 2009-11 Priority Number)



09-11 #	Bridge Number	Bridge Name	Mile Post	Region	Bridge Length	Total Project\$
17	207/4	WENATCHEE RIVER	4.22	North Central	216	\$580,000
Total Number of Bridges = 1					Total Project \$ =	\$580,000

Steel Bridge Paint Form

2009-11 Biennium Priority Array




Bridge Number: 207 / 4		Bridge Name: WENATCHEE RIVER		Milepost: 4.22	Region: North Central
Year Built 1940	Bridge Type: ST CTB		Steel Span Length: 160 ft.	Width (curb-curb): 24 ft.	Steel Tonnage: 145
Paint Age: 20	Paint Color: Evergreen	34097	Steel Surf. Area: 21,750 sqft	BMS Cond State 2: 5,000 sqft	BMS Cond State 3: 1,000 sqft
Next Paint Year: 2013	2007-09 Rank: 18	2009-11 Rank: 17	CPMS Ad date:	Paint Pin Number:	Cost Est\$/Ton: \$4,000
					Future Paint Cost: \$580,000

Past Paint History

Years	Cycle
1988	11
1977	6
1971	14
1957	8
1949	

Painting Cycle

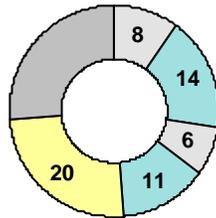

■ = Current Paint Age



Bridge Inspection Notes:

Small areas of peeling paint and blistered paint on steel stringers. Rust blooms and peeling paint scattered throughout top of truss and upper lateral brace members. A few small areas of peeling paint and rust blooms and areas of light rust between bottom chord built-up members.

STEEL TRUSS - Some rust pitting of panel point gusset plates. Heavy amounts of gravel and sand on the top of and inside of the bottom chord and lower panel point gusset plates.

STEEL FLOOR BEAMS - Minor rust in top flanges at deck interface, due to leaking joints above.

Deck joints need to be sealed as part of the painting project.