



NOTES


1. Attach sign to Z-Bar or windbeam with 3/16" rivets at 4" staggered spacing.
2. A nylon washer shall be placed between the sign face and any other washer required on signs constructed of Type III or IV sheeting.
3. A bent plate may be used in lieu of the welded plates shown. Both shall be galvanized after fabrication.
4. The bracket to barrier fasteners shall be 5/8" diameter resin bonded anchors (all thread) ASTM A193 Grade B7 or ASTM A449 (galvanized) with matching nut and washer. Epoxy resin shall conform to Standard Specification 9-26.1
5. Details shown in other views are common in both brackets.

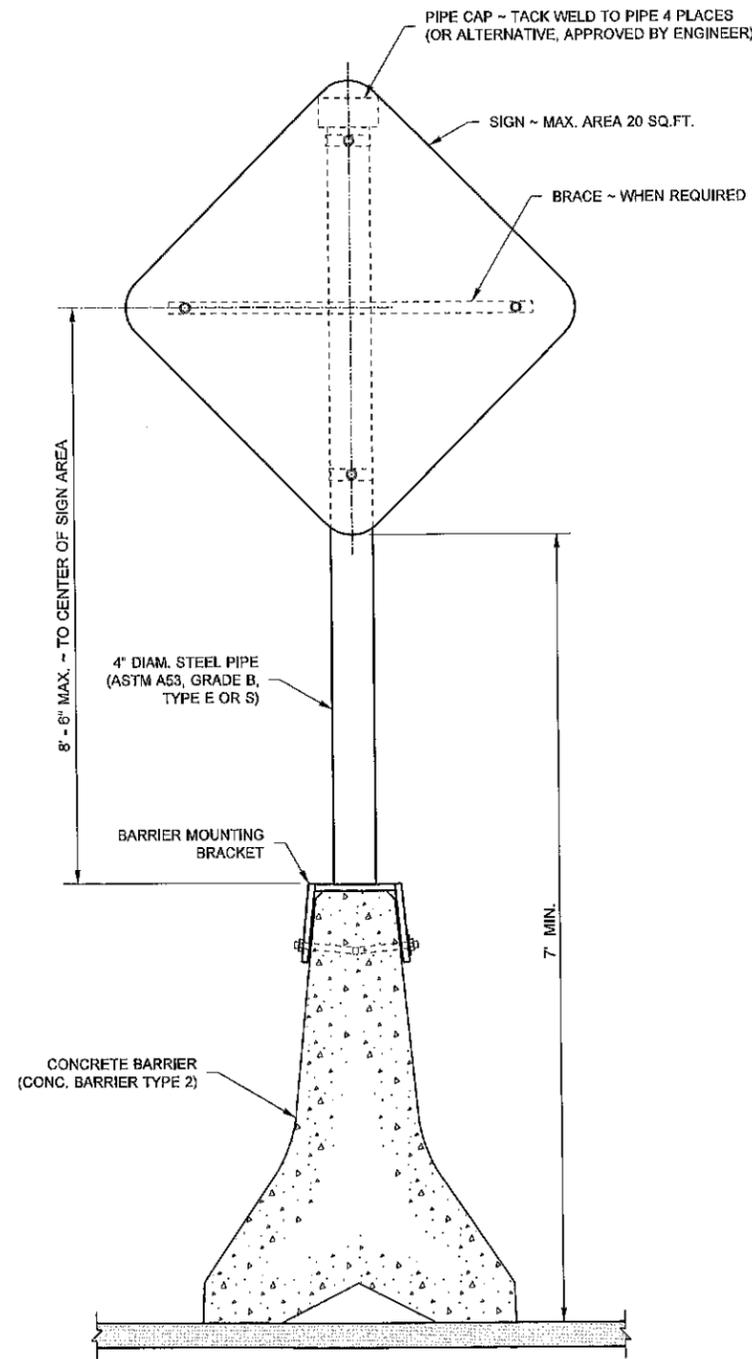


**TYPICAL SECTION
BARRIER MOUNTED SIGN SUPPORT**

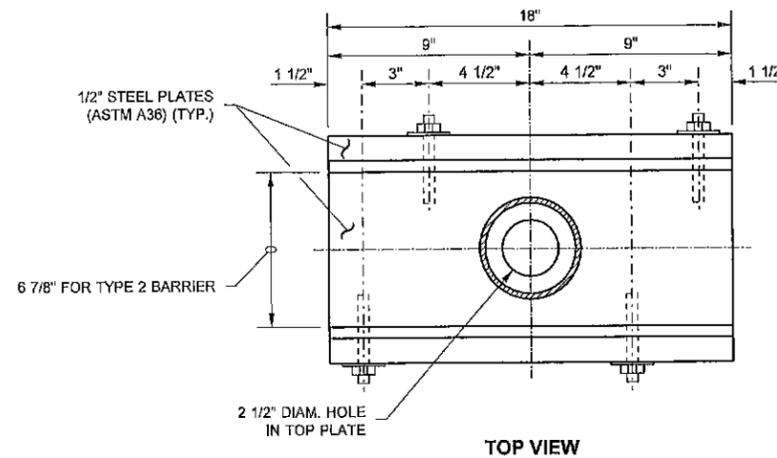

TOP VIEW

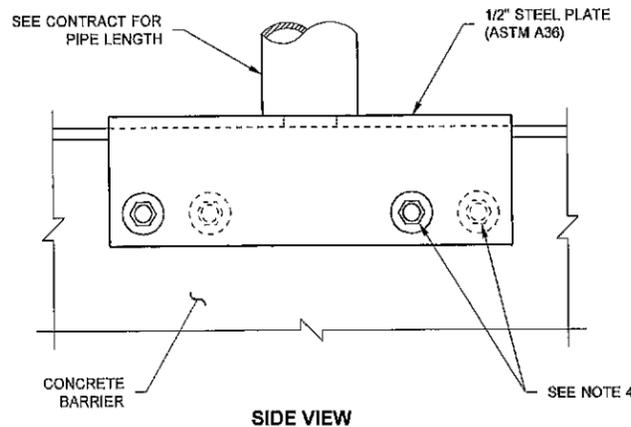


SIDE VIEW

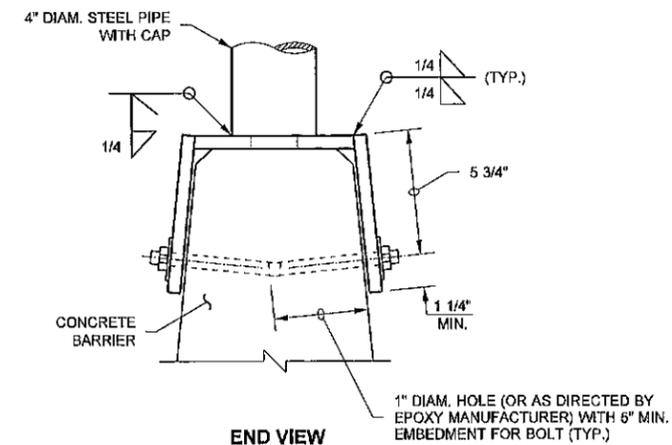

END VIEW

BARRIER MOUNTING BRACKET

SEE NOTE 3

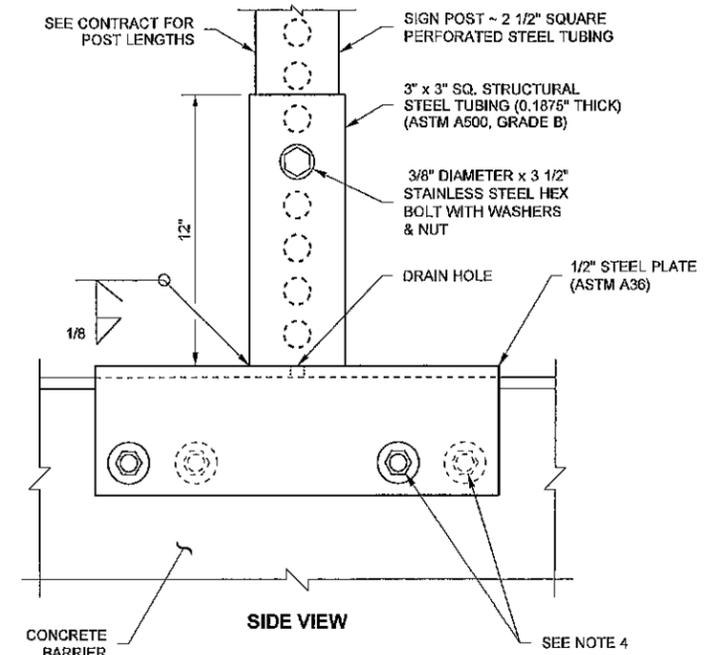

SIDE VIEW

SEE NOTE 6
FOR SQUARE TUBING SIGN POSTS SUPPORTING
SIGNS WITH A MAXIMUM AREA OF 9 SQ.FT.

**OPTIONAL "MANUFACTURED" BARRIER
MOUNTING BRACKET**

FILE NAME	C:\Users\CyfordL\Music\Desktop\SD-1.dgn	REGION NO.	10	STATE	WASH	FED. AID PROJ. NO.				PLOT 1
TIME	3:22:16 PM	JOB NUMBER		LOCATION NO.						SD-1
DATE	2/5/2013	CONTRACT NO.								SHEET
PLOTTED BY	CyfordL									OF
DESIGNED BY										SHEETS
ENTERED BY										
CHECKED BY										
PROJ. ENGR.										
REGIONAL ADM.										
	REVISION			DATE	BY					